



SMART-DRY 4 DRYING CABINET

STANDARD FEATURES

- Automatic & manual programs
- Preset start time
- Temperature & humidity tracking system
- Energy-efficient
- · Electric heated air drying
- Gentle drying technology without mechanical action
- · Double overheat protection
- Powder coated galvanized steel
- Program ends with "cool down" mode
- Interior lighting
- Sturdy construction ensures durability and reliability
- · Versatile drying options for added convenience
- Ideal for delicate and hard to dry textiles and accessories

INCLUDED ACCESSORIES

- Hanging rod
- Four Dry Kwik coat hangers
- Two ventilated shelves




OPTIONAL ACCESSORIES

• Door hook racks that attach on the inside of the door for drying additional accessories






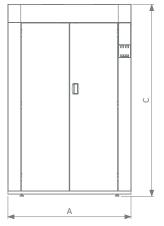

LEFT SIDE



FROM ABOVE

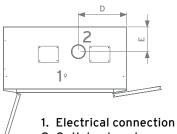

2. Outlet exhaust

Dimensions in/mm

В

С

D

Ε



Width 47 / 1200

Depth 25.2 / 640

Height 74 / 1870

18.5 / 469

Exhaust position from side

Exhaust position from back

9.5 / 242

TECHNICAL SPECIFICATIONS SMART-DRY 4 DRYING CABINET

Machine Type		Drying Cabinet
Product Name		Smart-Dry 4
Product No.		SDC4
Main Data		
Туре		Air vented
Capacity, sets of turnout gear		4
Capacity (dry weight)	lbs / kg	22 / 10
Interior capacity	cu ft / L	34.7 / 983
Drying capacity	oz/min / g/min	2.2 / 62
Energy consumption	kWh	3.0
Noise emission	dB(A)	62
Electrical Installation		
Supply Voltage	V	208-240v, 1ph, 60Hz
Electric heating	W	4500
Electric fan	W	350
Total effect	W	4850
Protection	Α	30
Dimensions		
Outer: width × depth × height	in / mm	47 × 25.2 × 74 / 1200 × 640 × 1870
Shipping: length × width × height	in / mm	68 × 25 × 48 / 1727 × 635 × 1219
	,	
Weight		
Weight	lb / kg	≈320 / ≈145
Shipping weight	lb / kg	420 / 191
Ventilation		
Outlet exhaust	Ø in / mm	6 / 152
Outlet airflow	cfm / m³/h	135 / 230
Pressure drop, max	psf / Pa	1.46 / 70
Maximum airflow (at 0% pressure)	cfm / m³/h	200 / 340
Optional Accessories		
Hooks for drying cabinet door: 3 separate rows with 4 hooks on each, 1 set = 1 door	Product No.	SDDH

For freight cost savings, the drying cabinet ships knocked down in a crate. Assembly is required.

